
 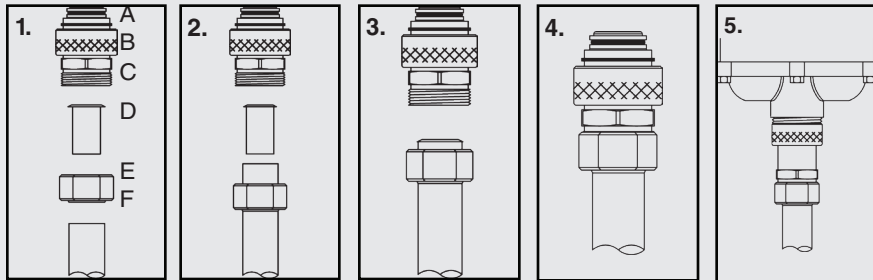


Product Instructions

Additional MANABLOC® Supply Adapter Connections

Compression / Male NPT / End Cap

THE WATER SUPPLY TO THE MANABLOC SHALL BE TURNED OFF BEFORE ATTEMPTING INSTALLATION OF CRIMP SUPPLY ADAPTERS.



1. Insure the sealing element (A) is in place and clean of any dirt or debris, wet sealing element with tap water.
2. Slide the supplied compression nut (E) with ferrule (F) onto the tubing (threads of the nut toward the end of the tubing). Nut comes assembled with ferrule.
3. Insert the supplied Stainless Steel Insert Stiffener (D) fully into the end of the PEX tubing as shown. Insert Stiffener is not required when making a connection to CPVC or copper tubing.
4. Insert the pipe fully into the MANABLOC Supply Adapter and thread compression nut onto fitting and wrench tighten (supporting the HEX on fitting body with a crescent wrench) 1 to 1-1/4 turns past hand tight. The piping must not be allowed to put stress on the MANABLOC, as leaking damage may result.
5. Insert the fitting into the desired inlet/outlet port until the fitting flange sets flush with the port. Thread the nut (B) onto the MANABLOC inlet/outlet port, hand tighten only. DO NOT OVER TIGHTEN.

Note: For male NPT MANABLOC Adapters (50646, 50656) use only Teflon® Tape to seal pipe threads.
DO NOT use pipe dopes, thread sealers, Teflon® pastes, etc.


 
For the End Cap Adapter (53601) follow steps 1. and 5.

Product Instructions

Additional MANABLOC® Supply Adapter Connections

Compression / Male NPT / End Cap

THE WATER SUPPLY TO THE MANABLOC SHALL BE TURNED OFF BEFORE ATTEMPTING INSTALLATION OF CRIMP SUPPLY ADAPTERS.

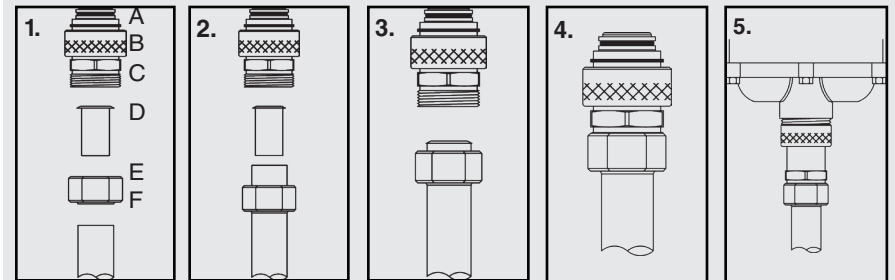

1. Insure the sealing element (A) is in place and clean of any dirt or debris, wet sealing element with tap water.
2. Slide the supplied compression nut (E) with ferrule (F) onto the tubing (threads of the nut toward the end of the tubing). Nut comes assembled with ferrule.
3. Insert the supplied Stainless Steel Insert Stiffener (D) fully into the end of the PEX tubing as shown. Insert Stiffener is not required when making a connection to CPVC or copper tubing.
4. Insert the pipe fully into the MANABLOC Supply Adapter and thread compression nut onto fitting and wrench tighten (supporting the HEX on fitting body with a crescent wrench) 1 to 1-1/4 turns past hand tight. The piping must not be allowed to put stress on the MANABLOC, as leaking damage may result.
5. Insert the fitting into the desired inlet/outlet port until the fitting flange sets flush with the port. Thread the nut (B) onto the MANABLOC inlet/outlet port, hand tighten only. DO NOT OVER TIGHTEN.

Note: For male NPT MANABLOC Adapters (50646, 50656) use only Teflon® Tape to seal pipe threads.
DO NOT use pipe dopes, thread sealers, Teflon® pastes, etc.

For the End Cap Adapter (53601) follow steps 1. and 5.