


PVC Touch Toe Waste & Overflow

Installation and Operating Instructions

CONTENTS

1)Overflow Elbow	7)Self-Taping Screws	13)Stopper
2)Overflow Gasket	8)Waste Test Cap	14)Trim Plate
3)O-Ring	9)Test Cap Gasket	15)Trim Plate Screw
4)Overflow Test Cap	10) Spud	16)Sanitary Tee'
5)Crossbar	11) Drain Gasket	17)Overflow Pipe*
6)Test Cap Screw	12) Waste Shoe	18)Drain Pipe*

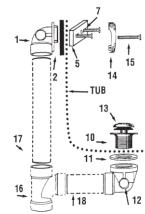

* Dashed items 16, 17 and 18 are ONLY included in the full kit

Installation Overflow

- 1. Assemble all parts without solvent welding the pipe elbow and shoe to ensure that the overflow pipe and drain pipe are cut to the proper length adjust if necessary.
- Place the overflow gasket onto the overflow elbow. Align the overflow elbow with the hole on the backside of the tub and secure using the crossbar and two self tapping screws. Fasten the trim plate to the crossbar with the trim plate screw.
- 3. Solvent weld the overflow elbow to the overflow pipe.

waste

- 4. Unscrew the stopper from the spud.
- 5. Place the drain gasket on top of the waste shoe and align it with the drain hole on the bottom of the tub.
- 6. Place a small bead of silicone caulk around the spud and tub (Do not use plumbers putty or any other oil based compound to create this seal). Screw the spud into the waste shoe from the top of the tub. Reinstall the stopper.
- 7. Solvent weld the waste shoe to the drain pipe.
- 8. Solvent weld the drain pipe and the overflow pipe into the sanitary tee. Allow all solvent welds to cure. Finally enjoy a hot bath you deserve it. Good job!